

Tachometer/Speedometer Needle Fluctuation

EL008-99

November 19, 1999


'00 Celica

Introduction

On the 2000 model year Celica the [tachometer](#) and speedometer needles will fluctuate when the ignition switch is turned on with the DCC 25 Amp fuse removed. Initial installation of this fuse should occur during PDS (Pre-Delivery Service). Tachometer/speedometer needle movement is a normal condition for this model with the DCC 25 Amp fuse removed.


Applicable Vehicles: 2000 model year Celica

Inspection Procedure

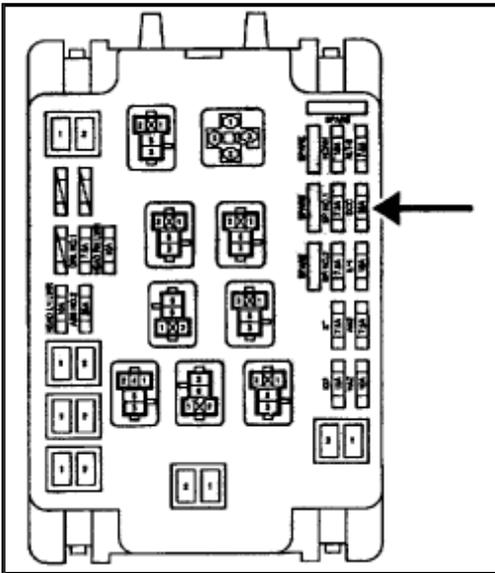

If a vehicle exhibits this condition, check that the DCC 25 amp fuse is in the Junction Block as shown.

NOTE:

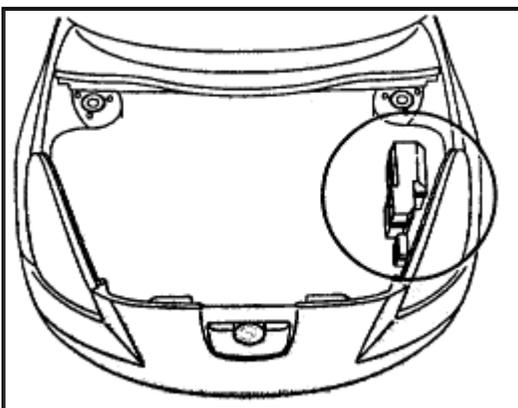

The DCC 25 Amp fuse is stored in the Engine Room Junction Block in the engine compartment. Refer to TSB PG027-99 for Celica Fuse Installation During POS.

OPCODE	DESCRIPTION	TIME	OPN	T1	T2
-	Not Applicable to Warranty	-	-	-	-